

特点  
加热装置  
一体型 3°  
一体型 CURVE  
一体型系列  
2 体型系列  
UNO  
强力型 热敏刀座  
Z  
直柄延长杆  
相关商品  
周边机器  
参考资料


**BT30**

一体型 3°





BT30-SLRA10-75-M22

一体型 CURVE CV

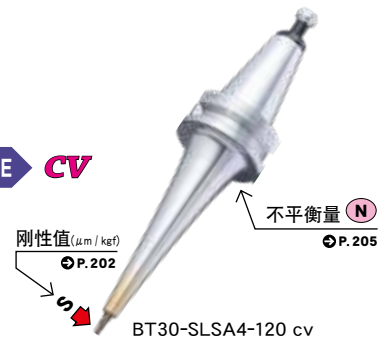

BT30-SLSA4-120 cv

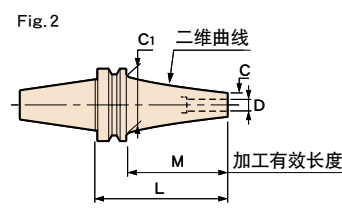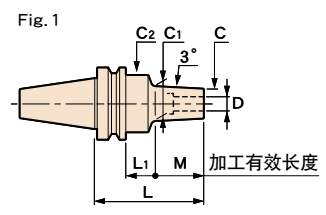

**■ 选购品**  
● 拉钉 → P.184

**■ 注意事项**  
● 拉钉...请在加热时取下,或使用通孔拉钉。  
● 刀具安装...插入刀具时,请务必将刀具插入比安全记号更深的位置。

型号	Fig.	φD	φC	t	L	M	L1	φC1	φC2	H	h	kg	N	S	缩略图
<b>BT30-SLSA3- 75-M22</b>	1	3	6	1.5	75	22	31	8.3	25	9	99	0.4	0.8	4.6	2
- 95-M42					95	42		10.4			119			9.2	3
-120-M67					120	67		13			144			0.5	1.6
<b>-SLRA3- 75-M22</b>	1	3	7.5	2.25	75	22	31	9.8	25	9	99	0.5	1.6	2.8	5
<b>BT30-SLSA3.175-75-M22</b>	1	3.175	6.175	1.5	75	22	31	8.5	25	9	99	0.4	0.8	4.4	6
-95-M42					95	42		10.6			119			8.8	7
<b>BT30-SLSA4- 75-M22</b>	1	4	7	1.5	75	22	31	9.3	25	12	99	0.4	0.8	3.6	8
- 95-M42					95	42		11.4			119			7.3	9
-120-M67					120	67		14			144			0.5	1.6
<b>-SLRA4- 75-M22</b>	1	4	10	3	75	22	31	12.3	25	12	99	0.5	1.6	1.8	11
<b>-SLSA4- 75 CV</b>	2	4	7	1.5	75	53	—	34	—	12	99	0.5	1	1.8	12
- 90 CV					90	68		114			1.1		2.8	13	
-120 CV					120	98		144			1.2		6.6	14	
<b>-SLRA4- 90 CV</b>	2	4	10	3	90	68	—	34	—	12	114	0.5	1	2	15
-120 CV					120	98		144			1.1		2.9	16	
<b>BT30-SLSA6- 75-M22</b>	1	6	9	1.5	75	22	31	11.3	25	18	99	0.4	0.9	2.4	17
- 95-M42					95	42		13.4			119			4.9	18
-120-M67					120	67		16			144			0.5	1.7
<b>-SLRA6- 75-M22</b>	1	6	12	3	75	22	31	14.3	25	18	99	0.4	0.9	1.4	20
<b>-SLSA6- 75 CV</b>	2	6	9	1.5	75	53	—	34	—	18	99	0.5	1.3	1.5	21
- 90 CV					90	68		114			1		2.4	22	
-120 CV					120	98		144			1.2		5.6	23	
<b>-SLRA6- 90 CV</b>	2	6	13	3.5	90	68	—	34	—	18	114	0.5	1.1	1.6	24
-120 CV					120	98		144			1.2		2.5	25	
<b>BT30-SLRA8- 75-M22</b>	1	8	14	3	75	22	31	16.3	25	24	99	0.4	0.9	1.2	26
<b>-SLSA8- 75 CV</b>	2	8	11	1.5	75	53	—	34	—	24	99	0.5	1.1	1.3	27
- 90 CV					90	68		114			0.6		1.6	2.2	28
<b>-SLRA8- 90 CV</b>	2	8	16	4	90	68	—	34	—	24	114	0.5	1.2	1.1	29

型号	Fig.	φD	φC	t	L	M	L <sub>1</sub>	φC <sub>1</sub>	φC <sub>2</sub>	H	h	Kg	N	S	缩略图
<b>BT30-SLRA10- 75-M22</b>	1	10	16	3	75	22	31	18.3	25	30	99	0.4	1	1.1	30
<b>-SLSA10- 75 CV</b>	2	10	13	1.5	75	53	—	34	—	30	99	0.5	1.6	1.2	31
<b>- 90 CV</b>					90	68					114		1.4	2	32
<b>-SLRA10- 90 CV</b>	2	10	19	4.5	90	68	—	34	—	30	114	0.6	1.5	1.1	33
<b>BT30-SLRA12- 75-M22</b>	1	12	20	4	75	22	31	22.3	25	30	99	0.5	1.2	1	34
<b>BT30-SLRA16- 60-M22</b>	1	16	26	5	60	22	16	28.3	34	32	60	0.5	1.6	0.5	35
<b>BT30-SLRA20- 65-M22</b>	1	20	32	6	65	22	21	34.3	40	38	60	0.6	2.1	0.4	36

■ 主轴锥孔用 清洁工具  
STAR DUST

型号  
CLT-NT30-G2  
P.194



S=1:5

φ3

<p><b>BT30-SLSA3-75-M22</b></p>	<p><b>BT30-SLSA3-95-M42</b></p>	<p><b>BT30-SLSA3-120-M67</b></p>	<p><b>BT30-SLRA3-75-M22</b></p>
---------------------------------	---------------------------------	----------------------------------	---------------------------------

φ3.175


<p><b>BT30-SLSA3.175-75-M22</b></p>	<p><b>BT30-SLSA3.175-95-M42</b></p>
-------------------------------------	-------------------------------------

φ4


<p><b>BT30-SLSA4-75-M22</b></p>	<p><b>BT30-SLSA4-95-M42</b></p>	<p><b>BT30-SLSA4-120-M67</b></p>	<p><b>BT30-SLRA4-75-M22</b></p>
<p><b>BT30-SLSA4-75 CV</b></p>	<p><b>BT30-SLSA4-90 CV</b></p>	<p><b>BT30-SLSA4-120 CV</b></p>	<p><b>BT30-SLRA4-90 CV</b></p>
<p><b>BT30-SLRA4-120 CV</b></p>			

φ6


BT30-SLSA6-75-M22

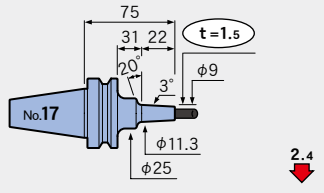


BT30-SLSA6-95-M42

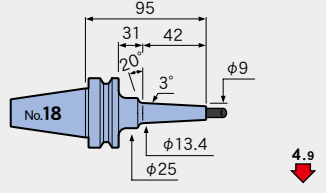


BT30-SLSA6-120-M67

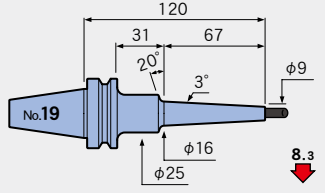


BT30-SLRA6-75-M22

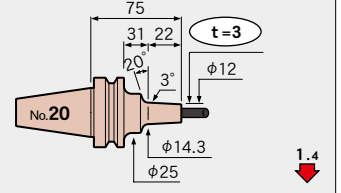


BT30-SLSA6-75 CV

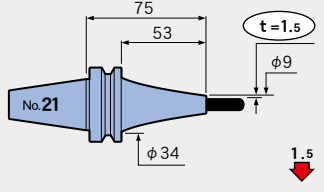


BT30-SLSA6-90 CV

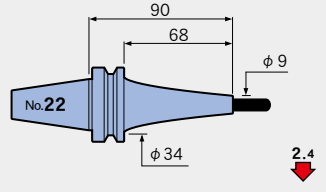


BT30-SLSA6-120 CV

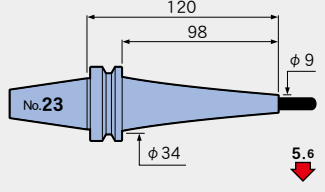

BT30-SLRA6-90 CV

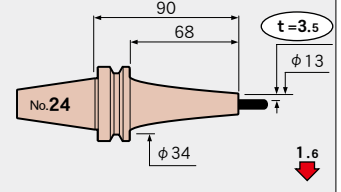


BT30-SLRA6-120 CV

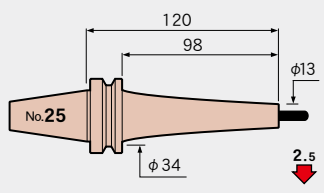


φ8


BT30-SLRA8-75-M22

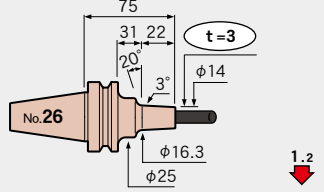


BT30-SLSA8-75 CV

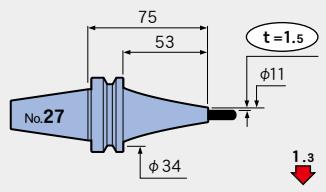

BT30-SLSA8-90 CV

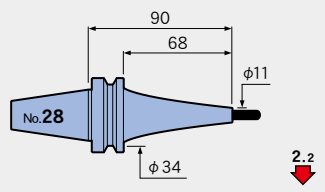


BT30-SLRA8-90 CV

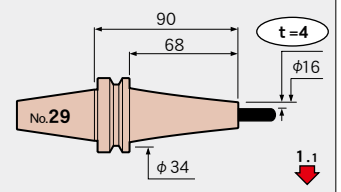


φ10


BT30-SLRA10-75-M22

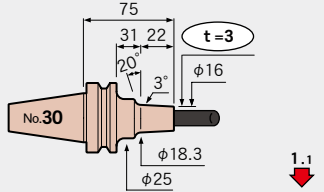


BT30-SLSA10-75 CV

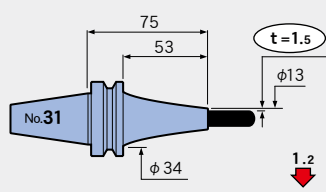

BT30-SLSA10-90 CV

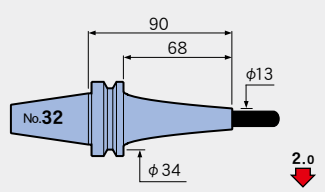


BT30-SLRA10-90 CV

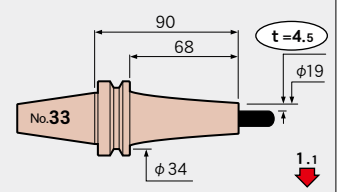


φ12

BT30-SLRA12-75-M22

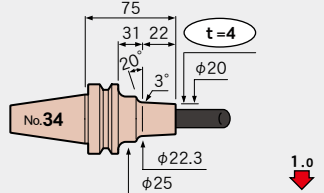

φ16

BT30-SLRA16-60-M22

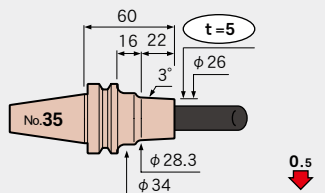

φ20

BT30-SLRA20-65-M22

